

# 

## **Model Number**

## UC500-30GM70-2E2R2-K-V15-Y

Ultrasonic diffuse sensor with separate transducer

#### **Features**

- 2 switch outputs
- Synchronization options
- Temperature compensation
- Can be parameterized via the ULTRA-PROG-IR software and interface (accessories)
- Custom configuration

Release date: 2020-03-09 15:23 Date of issue: 2020-03-09 70111537\_eng.xml

Dead band Standard target plate Transducer frequency Response delay Nominal ratings Temperature drift Time delay before availability t Limit data Permissible cable length Indicators/operating means LED yellow LED green/yellow Potentiometer **Electrical specifications** Rated operating voltage U<sub>e</sub> Operating voltage U<sub>B</sub> Ripple No-load supply current I<sub>0</sub> Interface Interface type Mode Input/Output Input/output type 0 Level 1 Level Input impedance Number of sensors Switching output Output type Default setting Repeat accuracy R Operating current IL Switching frequency Switching hysteresis Voltage drop Off-state current Ambient conditions Ambient temperature Storage temperature Shock resistance Vibration resistance **Mechanical specifications** Connection type Degree of protection Material Housing Cable Transducer Installation position Mass Construction type Cable length Factory settings Output 1 Output 2 Response delay Beam width Sensitivity Compliance with standards and directives Standard conformity Standards Approvals and certificates UL approval CCC approval

Technical data General specifications

Sensing range Adjustment range UC500-30GM70-2E2R2-K-V15-Y

55 ... 500 mm 50 ... 500 mm 0 ... 55 mm 100 mm x 100 mm approx. 300 kHz < 60 ms  $\leq \pm 1.5$  % of full-scale value ≤ 85 ms max. 300 m solid Switching state switch output 1 yellow: switching state switch output 2 green: Teach-In Switching output 1 and Switching output 2 adjustable 24 V DC 12 ... 30 V DC (including ripple) ≤ 10 % ≤ 50 mA Infrared point-to-point connection 1 synchronization connection, bidirectional (Factory setting: synchronized mode ) / Teach-In input < 3 V  $\geq$  15 V typ. 900 Ω max. 10 2 switch outputs PNP, NO/NC, programmable 50 ... 500 mm ( adjustable via potentiometer ) ± 0.5 mm Per 150 mA , short-circuit/overload protected ≤5 Hz 5 mm (programmable)  $\leq 3 V$  $\leq 10 \, \mu A$ -25 ... 70 °C (-13 ... 158 °F) -40 ... 85 °C (-40 ... 185 °F) 30 g , 11 ms period  $10 \dots 55 \mbox{ Hz}$  , Amplitude  $\pm 1 \mbox{ mm}$ Connector plug M12 x 1 , 5-pin IP65 brass, nickel-plated PVC epoxy resin/hollow glass sphere mixture; polyurethane foam any position 190 g Cylindrical 165 cm Normally open (NO) Normally closed (NC) 100 cycles width 50 % 75 % EN 60947-5-2:2007+A1:2012 IEC 60947-5-2:2007 + A1:2012 cULus Listed, General Purpose

CCC approval / marking not required for products rated  $\leq$ 36 V

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

Pepperl+Fuchs Group www.pepperl-fuchs.com USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com

F779 9091 **FEPPERL+FUCHS** 


1


# Dimensions

# **Additional Information**


# Switching outputs operating mode

Switching output mode

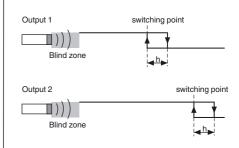



# **Electrical Connection**



# **Pinout**



## Wire colors in accordance with EN 60947-5-2

1	BN	(brown)
2	WH	(white)
3	BU	(blue)
4	BK	(black)
5	GY	(gray)

fa-info@us.pepperl-fuchs.com

www.pepperl-fuchs.com

# Accessories

## BF 30

Mounting flange, 30 mm

## BF 5-30

Universal mounting bracket for cylindrical sensors with a diameter of 5 ... 30 mm

#### V15-G-2M-PUR Female cordset, M12, 5-pin, PUR cable

UC-18/30GM-IR

# ULTRA-PROG-IR

Configuration software for ultrasonic sensors

**BF 18** Mounting flange, 18 mm

# **Description of Sensor Functions**

# **Displays and Controls**

The sensor has two potentiometers and two display LEDs.

LED 1 (yellow)	On/off: Switching state of switching output 1 Flashing: Error when setting the switching points (switching point 2 < switching point 1). This state only occurs in window function operating mode (2 switching points).	LED 1 potentiometer 2 connector
LED 2 (yellow)	On/off: Switching state of switching output 2 Flashing: Error when setting the switching points (switching point 2 < switching point 1). This state only occurs in window function operating mode (2 switching points).	
LED 2 (green)	approx. 500 ms on: Range limit taught in Off: Normal mode	
Potentiometer 1	Setting a switching point (Default setting: Setting the switching point of switching output 1)	potentiometer 1 LED 2 temperature yellow / green sensor
Potentiometer 2	Setting a switching point (Default setting: Setting the switching point of switching output 2)	

## Setting the Sensor Using the Potentiometers


The sensor is equipped with two potentiometers. These potentiometers are assigned to the two switching outputs by default. The switching outputs operate in switching point mode by default. Potentiometer P1 is used to set the switching point on switching output 1. Potentiometer P2 is used to set the switching point on switching output 2.

# Note:

The function of the potentiometer can be altered using the ULTRA-PROG-IR software. As soon as a configuration has been changed, the potentiometer function selected using ULTRA-PROG-IR is activated.

## Parameterization via ULTRA-PROG-IR

In order to be able to set the sensor parameters and adjust the sensor to the respective application, the sensor is able to communicate with a PC via the integrated infrared interface. The UC-18/30GM-IR interface cable is required to allow communication via this method. This cable is connected to an unused USB port on the PC.



The ULTRA-PROG-IR parameterization software is also required for setting the sensor parameters. The ULTRA-PROG-IR software can be downloaded for free from the **www.pepperl-fuchs.com** website. The software allows all open parameters to be set, including:

- All trip points and switching hystereses
- Output modes and behaviors
- Delay times
- Settings and setting ranges of the potentiometer
- Settings for teach-in and synchronization
- Definition of blind zones
- Sensor modes and measurement methods
- Filtering measurement values

The following service functions are also available:

- Observing and recording measurement values
- Diagnosing interference reflections

Pepperl+Fuchs Group www.pepperl-fuchs.com USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com Germany: +49 621 776 1111 fa-info@de.pepperl-fuchs.com Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com

# Teach-in

The sensor is equipped with a function input (XI). In order to teach in a limit value, this sensor must be parameterized as the Teach-in input using the ULTRA-PROG-IR parameterization software. This parameterization software allows you to specify what limit value is taught in. **Note:** 

The Teach-in function is not activated when the sensor is delivered.

#### Description of the Teach-in process:

1. Position an object at the required distance.

- 2. Connect the Teach-in input to L-.
  - The green LED lights up briefly after approx. 3 seconds. This indicates that the required distance has been successfully saved.
- 3. Disconnect the Teach-in input from L-.

#### Note:

If the Teach-in input remains connected to L-, the Teach-in process is repeated every 3 seconds.

#### Synchronization

The sensor features a function input (XI). Using the ULTRA-PROG-IR parameterization software, this function input can be configured as a synchronization input to suppress mutual interference from external ultrasonic signals. This is illustrated in the following description. If the synchronization input is not connected, the sensor operates with internally generated cycle pulses.

#### **External synchronization**

The sensor can be synchronized by applying external rectangular pulses. The pulse duration must be  $\geq$  100 µs. Each rising pulse edge sends an individual ultrasonic pulse. If the signal at the synchronization input is high, the sensor reverts to the normal, unsynchronized operating mode. If a low signal is applied to the synchronization input, the sensor switches to standby. In this operating mode, the last recorded output statuses are retained.

## Internal synchronization

#### Common mode operation

Up to ten sensors can be synchronized with each other. To do this, the synchronization inputs of the individual sensors are connected to each other. When configured in this state, all of the sensors send the ultrasonic signals together at the same time. The cycle rate corresponds to the cycle rate of the sensor with the lowest rate.

#### Multiplex mode

Up to ten sensors can work in multiplex mode; i.e. the sensors send their ultrasonic signals in succession. This prevents the sensor signals interfering with each other. In multiplex mode, the synchronization inputs of all sensors are connected to each other. An address must also be assigned to each sensor using the ULTRA-PROG-IR parameterization software, and the number of sensors to be synchronized must be determined. To start multiplex mode, all sensors are commissioned together by switching on the power supply.