### weCat3D


# MLSL101 LASER

Part Number



- Compact, lightweight design even suitable for robot applications
- Precise measuring range resolution X (> 1200 measuring points)
- Up to 3.6 million measuring points per second

2D/3D Profile Sensors project a laser line onto the object to be detected and generate an accurate, linearized height profile with an internal camera which is set up at a triangulation angle. Thanks to its uniform, open interface, the weCat3D series can be incorporated by means of the DLL program library or the GigE Vision standard without an additional control unit. Alternatively, wenglor offers its own software packages for implementing your application.

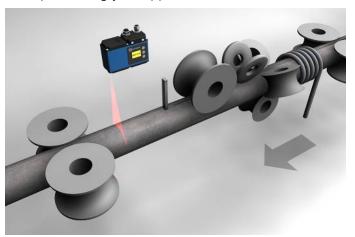

## **Technical Data**


Optical Data	
Working range Z	72108 mm
Measuring range Z	36 mm
Measuring range X	2734 mm
Linearity Deviation	18 <i>µ</i> m
Resolution Z	3,35,2 μm
Resolution X	2228 μm
Light Source	Laser (red)
Wavelength	660 nm
Laser Class (EN 60825-1)	1M
Max. Ambient Light	5000 Lux
Electrical Data	
Supply Voltage	1830 V DC
Current Consumption (Ub = 24 V)	300 mA
Measuring Rate	2004000 /s
Subsampling	8004000 /s
Temperature Range	045 °C
Storage temperature	-2070 °C
Inputs/Outputs	4
Switching Output Voltage Drop	< 1,5 V
Switching Output/Switching Current	100 mA
Short Circuit Protection	yes
Reverse Polarity Protection	yes
Overload Protection	yes
Interface	Ethernet TCP/IP
Baud Rate	100/1000 Mbit/s
Protection Class	III
FDA Accession Number	1610443-001
Mechanical Data	
Housing Material	Aluminium; Plastic
Degree of Protection	IP67
Connection	M12 × 1; 12-pin
Type of Connection Ethernet	M12 × 1; 8-pin, X-cod.
Optic Cover	Plastic
Weight	290 g
Web server	yes
Configurable as PNP/NPN/Push-Pull	•
Switchable to NC/NO	
Connection Diagram No.	1022 1034
Control Panel No.	X2 A22
Suitable Connection Equipment No.	50 87
Suitable Mounting Technology No.	343
Display brightness may decrease with age. This does not re	
Display prigniness may decrease with age. This does not re	esull in any impairment of the

Display brightness may decrease with age. This does not result in any impairment of the sensor function.


#### Complementary Products

	Complementary Froducts				
	Control Unit				
	Cooling Unit ZLSK001				
	Protective Housing ZLSS003				
	Protective Screen Retainer ZLSS001				
	Software				
	Switch EHSS001				




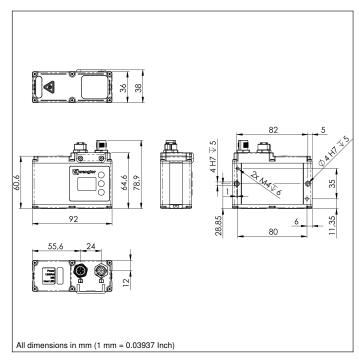


## Ctrl. Panel

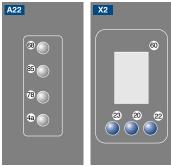


- 20 = Enter Button
- 22 = UP Button
- 23 = Down Button
- 4a = User LED
- 60 = Display
- 68 = Supply Voltage Indicator
- 78 = Module status
- 85 = Link/Act LED

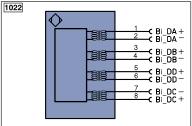

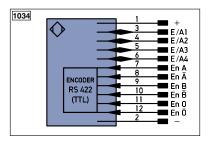

Leger	nd	PT	Platinum measuring resistor	ENARS422	Encoder A/Ā (TTL)
+	Supply Voltage +	nc	not connected	ENBRS422	Encoder B/B (TTL)
_	Supply Voltage 0 V	U	Test Input	ENA	Encoder A
~	Supply Voltage (AC Voltage)	Ū	Test Input inverted	ENB	Encoder B
Α	Switching Output (NO)	W	Trigger Input	Amin	Digital output MIN
Ā	Switching Output (NC)	W-	Ground for the Trigger Input	Амах	Digital output MAX
V	Contamination/Error Output (NO)	0	Analog Output	Аок	Digital output OK
V	Contamination/Error Output (NC)	0-	Ground for the Analog Output	SY In	Synchronization In
E	Input (analog or digital)	BZ	Block Discharge	SY OUT	Synchronization OUT
Т	Teach Input	Awv	Valve Output	OLT	Brightness output
Z	Time Delay (activation)	а	Valve Control Output +	М	Maintenance
S	Shielding	b	Valve Control Output 0 V	rsv	reserved
RxD	Interface Receive Path	SY	Synchronization	Wire Colors according to IEC 60757	
TxD	Interface Send Path	SY-	Ground for the Synchronization	BK	Black
RDY	Ready	E+	Receiver-Line	BN	Brown
GND	Ground	S+	Emitter-Line	RD	Red
CL	Clock	±	Grounding	OG	Orange
E/A	Output/Input programmable	SnR	Switching Distance Reduction	YE	Yellow
0	IO-Link	Rx+/-	Ethernet Receive Path	GN	Green
PoE	Power over Ethernet	Tx+/-	- Ethernet Send Path	BU	Blue
IN	Safety Input	Bus	Interfaces-Bus A(+)/B(-)	VT	Violet
OSSD	Safety Output	La	Emitted Light disengageable	GY	Grey
Signal	Signal Output	Mag	Magnet activation	WH	White
	- Ethernet Gigabit bidirect, data line (A		Input confirmation	PK	Pink
	2 Encoder 0-pulse 0-0 (TTL)	EDM	Contactor Monitoring	GNYE	Green/Yellow

# Measuring field X, Z

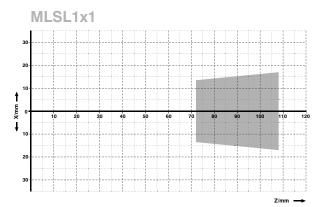



X = Measuring Range











