













Model Number

OBR25M-R200-A5-IO-V1-L

Laser retroreflective sensor with 4-pin, M12 x 1 connector

Features

- Medium design with versatile mounting options
- DuraBeam Laser Sensors durable and employable like an LED
- Extended temperature range -40°C ... 60°C
- · High degree of protection IP69K
- IO-link interface for service and process data

Product information


The optical sensors in the series are the first devices to offer an end-to-end solution in a medium-sized standard design—from the thru-beam sensor through to the measuring distance sensor. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.


The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

Multi Pixel Technology (MPT) ensures that the standard sensors are flexible and can be adapted to the application environment.

Dimensions

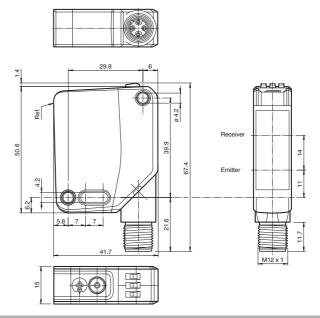

Electrical connection




Pinout

Wire colors in accordance w

1 BN (brow
2 WH (white



Indicators/operating means



1	Sensitivity adjustment	
2	Light-on / dark-on changeover switch	
3	Operating indicator / dark on	GN
4	Signal indicator	YE
5	Operating indicator / light on	GN

Technical data

General specifications

Effective detection range 0.5 ... 25 m Reflector distance 33 m Threshold detection range H85-2 reflector Reference target Light source laser diode

Light type modulated visible red light

Polarization filter

Laser nominal ratings

LASER LIGHT, DO NOT STARE INTO BEAM

0 ... 25 m

Laser class Wave length

Beam divergence > 5 mrad d63 < 2 mm in the range of 250 mm ... 750 mm

Pulse length 1.6 µs Repetition rate max 17.6 kHz max. pulse energy 9.6 nJ

Diameter of the light spot approx. 50 mm at a distance of 25 m

Angle of divergence approx. 0.1

Ambient light limit EN 60947-5-2: 60000 Lux

Functional safety related parameters

672 a $MTTF_d$ Mission Time (T_M) 20 a Diagnostic Coverage (DC) 0 %

Indicators/operating means

Operation indicator LED green:

constantly on - power on flashing (4Hz) - short circuit

flashing with short break (1 Hz) - IO-Link mode

Function indicator Yellow LED

Permanently lit - light path clear Permanently off - object detected

Flashing (4 Hz) - insufficient operating reserve

Control elements Light-on/dark-on changeover switch

sensitivity adjustment Control elements

Electrical specifications

Process data witdh

Operating voltage 10 ... 30 V DC max. 10 %

< 15 mA at 24 V Operating voltage No-load supply current

Protection class

Interface

IO-Link (via C/Q = pin 4) Interface type Device profile Identification and diagnosis Smart Sensor type 2.4

COM 2 (38.4 kBaud) Transfer rate

IO-Link Revision 1.1 Min. cycle time 2.3 ms

Process data output 2 Bit

SIO mode support

Device ID 0x111220 (1118752)

Compatible master port type

Output

The switching type of the sensor is adjustable. The default Switching type

setting is:

C/Q - Pin4: PNP normally open / dark-on, IO-Link /Q - Pin2: PNP normally closed / light-on

2 PNP outputs, short-circuit-proof, reverse polarity protection,

surge-proof

Process data input 2 Bit

max. 30 V DC

250 μs

max. 100 mA, resistive load Switching current DC-12 and DC-13 Usage category

≤ 1.5 V DC Voltage drop U_d Switching frequency f 2000 Hz

Response time Conformity

Laser safety

Signal output

Switching voltage

Communication interface IEC 61131-9 Product standard EN 60947-5-2 EN 60825-1:2014

Ambient conditions

Ambient temperature -40 ... 60 °C (-40 ... 140 °F)

Storage temperature -40 ... 70 °C (-40 ... 158 °F)

Mechanical specifications

Housing width 15 mm Housing height 50.6 mm

Laserlabel



CLASS 1 LASER PRODUCT

IEC 60825-1: 2007 certified. Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50. dated June 24, 2007

CLASS 1 LASER PRODUCT

IEC 60825-1: 2007 certified. Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007

Accessories

IO-Link-Master02-USB

IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

OMH-MLV12-HWK

Mounting bracket for series MLV12 sensors

OMH-R200-01

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

OMH-R20x-Quick-Mount

Quick mounting accessory

OMH-MLV12-HWG

Mounting bracket for series MLV12 sensors

REF-H85-2

Reflector, rectangular 84.5 mm x 84.5 mm, mounting holes

REF-C110-2

Reflector, round ø 84 mm, central mounting hole

REF-H50

Reflector, rectangular 51 mm x 61 mm, mounting holes, fixing strap

REF-VR10

Reflector, rectangular 60 mm x 19 mm, mounting holes

OFR-100/100

Reflective tape 100 mm x 100 mm

REF-MH82

Reflector with Micro-structure, rectangular 82 mm x 60 mm, mounting holes


REF-MH78




Housing depth	41.7 mm
Degree of protection	IP67 / IP69 / IP69K
Connection	4-pin, M12 x 1 connector, 90° rotatable
Material	
Housing	PC (Polycarbonate)
Optical face	PMMA
Mass	арргох. 37 g
American and contification	
Approvals and certificates	
UL approval	E87056 , cULus Listed , class 2 power supply , type rating 1
UL approval CCC approval	E87056 , cULus Listed , class 2 power supply , type rating 1 CCC approval / marking not required for products rated ≤36 V

Curves/Diagrams

Characteristic response curve

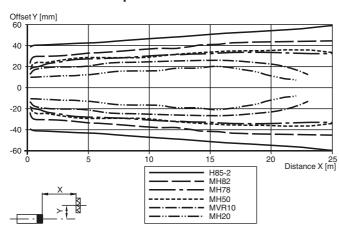

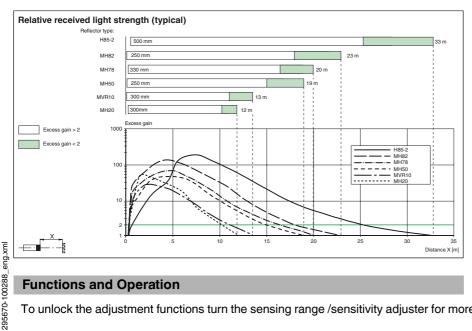

Functions and Operation

To unlock the adjustment functions turn the sensing range /sensitivity adjuster for more than 180 degrees.

Sensing Range / Sensitivity

Turn sensing range / sensitivity adjuster clockwise to increase sensing range / sensitivity.

Turn sensing range / sensitivity adjuster counter clockwise to decrease sensing range / sensitivity.

If the end of the adjustment range is reached, the signal indicator starts flashing with 8 Hz.

Light-on / Dark-on Configuration

Press the light-on / dark-on changeover switch for more than 1 second (less than 4 seconds). The light-on / dark-on mode changes and the operating indicators are activated accordingly.

If you press the light-on / dark-on changeover switch for more than 4 seconds, the light-on /dark-on mode changes back to the original setting. On release of the light-on / dark-on changeover switch the current state is activated.

Restore Factory Settings

Press the light-on / dark-on changeover switch for more than 10 seconds (less than 30 seconds) until all LEDs turn off. On release of the light-on / dark-on changeover switch the signal indicator turns on. After 5 seconds the sensor resumes operation with factory default settings.

After 5 minutes of inactivity the sensing range / sensitivity adjustment is locked. In order to reactivate the sensing range / sensitivity adjustment, turn the sensing range /sensitivity adjuster for more than 180 degrees.