







## **Model Number**

UGB-18GM50-255-2E3-150MM-V15-Y

#### **Features**

- Ultrasonic system for splice detection
- Insensitive to printing, colors, and shining surfaces
- Very high processing speeds are possible.
- Short version

## **Diagrams**

# Mounting/Adjustment Suggestions:

a = 5 mm ... 15 mm b ≥ 10 mm d = 40 mm ... 45 mm β = 20' ... 40'

## **Technical data**

General specifications
------------------------

Sensing range 20 ... 60 mm , optimal distance: 45 mm
Transducer frequency 255 kHz

Transducer frequency 255 Indicators/operating means

LED green Display: readiness
LED yellow Display: splice detected
LED red Indication: No sheet detected (Air)

**Electrical specifications** 

Operating voltage U<sub>B</sub> 18 ... 30 V DC , ripple 10 %<sub>SS</sub>

No-load supply current  $I_0$  < 60 mA Time delay before availability  $t_v$  < 500 ms

Input

Input type Teach-In input

0-level: -U<sub>B</sub> ... -U<sub>B</sub> + 1V 1-level: +U<sub>B</sub> - 1 V ... +U<sub>B</sub>

Pulse length  $\geq 500 \text{ ms}$  Impedance  $\geq 10 \text{ k}\Omega$ 

Output

Output type 2 switch outputs PNP, NC

Rated operating current I<sub>e</sub> 2 x 100 mA , short-circuit/overload protected

 $\begin{array}{lll} \mbox{Voltage drop U}_d & \leq 3 \ \mbox{V} \\ \mbox{Switch-on delay t}_{on} & \leq 600 \ \mu \mbox{S} \\ \mbox{Switch-off delay t}_{off} & \leq 600 \ \mu \mbox{S} \\ \end{array}$ 

Pulse extension ≥ 120 ms programmable

Ambient conditions

Ambient temperature 0 ... 60 °C (32 ... 140 °F) Storage temperature -40 ... 70 °C (-40 ... 158 °F

Storage temperature  $-40 \dots 70 \,^{\circ}\text{C} \, (-40 \dots 158 \,^{\circ}\text{F})$  Mechanical specifications

Connection type Cable connector M12 x 1 , 5-pin with PVC Cable, 150 mm

Degree of protection IF

Material

Housing nickel plated brass; plastic components: PBT
Transducer epoxy resin/hollow glass sphere mixture; polyurethane foam

 $\begin{array}{ll} \text{Mass} & 150 \text{ g} \\ \text{Cable length} & \text{I1} = 0.3 \text{ m} \\ \text{I2} = 0.15 \text{ m} \\ \end{array}$ 

Compliance with standards and

directives
Standard conformity


Standards EN 60947-5-2:2007+A1:2012 IEC 60947-5-2:2007 + A1:2012

Approvals and certificates


UL approval cULus Listed, General Purpose CSA approval cCSAus Listed, General Purpose

CCC approval CCC approval / marking not required for products rated ≤36 V

## Dimensions

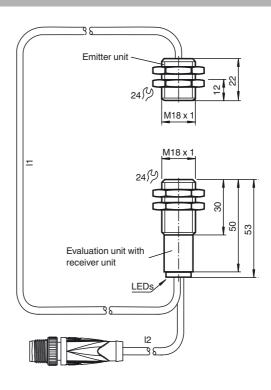

#### **Electrical Connection**

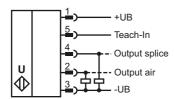

## Operation in applications with increased ESD requirements

Using the included metal screw caps, the sensor can be used in applications with increased ESD requirements up to 30 kV (ESD = electrostatic discharge). The metal coupling nuts are screwed on the front of the transmitter and receiver. The installation of the transmitter and receiver must ensure a large area electrical connection to the machine earth.

## **Description of sensor functions**

The ultrasonic double sheet monitor for splice detection can be used in all applications, where an automatic detection of glue dots, splices, bondings or the absence of base material is required, to protect machines or to evade waste production. The double-sheet monitor is based on the ultrasonic through-beam principle. The following can be detected:

- No base material, i.e. air,
- glue dots, splices, bondings

A microprocessor system evaluates the signals. The appropriate switch outputs are set as a result of the evaluation. Changes in ambient conditions such as temperature and humidity are compensated for automatically. The interface electronics is integrated into a compact M18 metal housing together with a sensor head.

## **Electrical connection**

The sensor is equipped with with a 5 pin connector. The functionality of the connections is described in the following table. The teach input (pin 5) is used to teach the sensor.

Pin	Switching on	Comments
1	+U <sub>B</sub>	
4	Switch output for splices	Pulse width corresponds to the event
2	Switch output for air	Pulse width corresponds to the event
5	-U <sub>B</sub> / n.c. / +U <sub>B</sub>	Normal operation / output pulse prolongation / TEACH-IN
3	-UB	

#### Normal mode

The sensor is working in normal mode if the function input (pin 5) is applied to -UB or not connected.

Displays:

LED yellow: Detection of splices

Power on LED green:

LED red: Detection of air (no base material)

Switch outputs:

The switch outputs are only active in normal operation!

pin 4: Splice output pin 2: Air output

#### Output pulse extension

If the teach input (pin 5) is not connected, when switching on the power supply, the sensor operates with output pulse prolongation. Events, shorter than 120 ms cause an output pulse duration of 120 ms at the Splice output. For sensor operation without pulse prolongation, the teach input (pin 5) has to be connected with -UB while power supply is switched on.

### Please note:

This can result in a condition in which more than one switch output is switched through!

## **Additional Information**

Angular misalignment



Sensor offset s < +/- 1 mm



PEPPERL+FUCHS

## **TEACH-IN mode**

Connecting the teach input (pin 5) with  $+U_B$  for at least 500 ms causes the sensor to change into TEACH-IN mode. The TEACH-IN procedure has to be carried out with base material. In case of inhomogeneous base materials we suggest to teach the sensor with activated material feeding and a corresponding prolongation of the TEACH-IN procedure.

During the TEACH-IN procedure flashes the yellow LED; the green LED is off.

After returning to the normal operation mode (teach input (pin 5) detached from +U<sub>B</sub>) the sensor indicates whether the TEACH-IN procedure was successful or not.

TEACH-IN procedure successful: green LED flashes 3 times

TEACH-IN procedure not successful: red LED flashes 3 times

#### Notes:

If two or more double sheet controls are used in the immediate vicinity of each other, there may be mutual interference between them, which can result in improper functionality of the devices. Mutual interference can be prevented by introducing suitable countermeasures when planning systems. Suitable measures can be:

- Mounting of sound absorbers (foam material)
- mounting of sound separators (sheet metal)
- insallation of the sensors with different directions of sound transmission.